


# NIMFE-EM12/4.0L61-UN6X-H1141/S1182 Magnetic Field Sensor – With TIN Coating For Detection of Ferromagnetic Parts



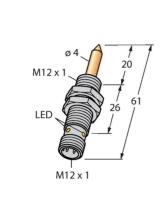

## Technical data

Туре	NIMFE-EM12/4.0L61-UN6X-H1141/S1182
ID no.	1600622
Remark to product	Optimized for the detection of weld nuts of the size of M5 to M10
Special version	S1182 corresponds to: TIN coating
Ambient temperature	-25+70 °C
Operating voltage	1030 VDC
Residual ripple	≤ 10 % U <sub>ss</sub>
DC rated operational current	≤ 100 mA
No-load current	≤ 15 mA
Residual current	≤ 0.1 mA
Isolation test voltage	≤ 0.5 kV
Short-circuit protection	yes / Cyclic
Voltage drop at I <sub>e</sub>	≤ 1 V
Wire breakage/Reverse polarity protection	yes / Complete
Output function	3-wire, Connection programmable, NPN
Design	Threaded barrel, M12 × 1
Dimensions	61 mm
Housing material	Stainless steel, 1.4301 (AISI 304)
Active area material	Stainless steel, 1.4301 (AISI 304), TIN coating
Max. tightening torque of housing nut	10 Nm
Electrical connection	Connector, M12 × 1

## Features

Threaded barrel, M12 x 1


Stainless steel, 1.4301

DC 3- wire, 10...30 VDC

Programmable (NC/NO) with teach adapter VB2-SP1

M12 x 1 connector

## Wiring diagram



## Functional principle


The weld sensors are available in different versions, with different signal intensities and diameters. Ferromagnetic parts which differ strongly in their material properties and diameters can thus be detected. A component to be detected must be located within the socalled optimal sensitive area in order to be detected.

This optimal sensitive area has a width of 0.5 mm and is laser-engraved on the tip of the probe, 11. 9 mm above of the M12 thread.




## **Technical data**

Vibration resistance	55 Hz (1 mm)
Shock resistance	30 g (11 ms)
Protection class	IP67
MTTF	874 years acc. to SN 29500 (Ed. 99) 40 °C
Power-on indication	LED, Green
Switching state	LED, Yellow



## Mounting instructions

#### Mounting instructions/Description

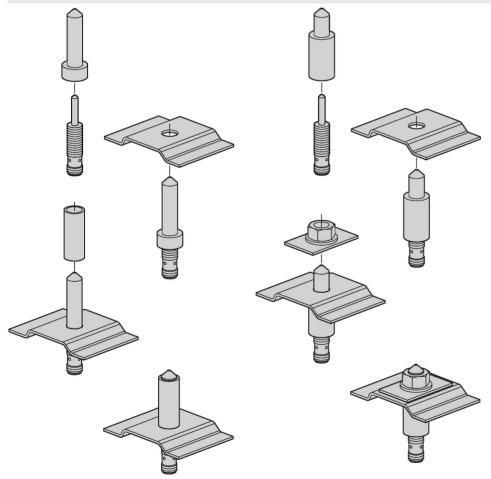

The magnetic field sensor for detection of ferromagnetic spares is especially suited for the detection of welding nuts as well as spacer or reinforcing sleeves. The parts to be detected must always consist of ferromagnetic material, so that a proper function can be guaranteed. Most applications need center bolts to tack

2|3



### Accessories

